SAFETY DATA SHEET

47500/67500

Product name	: MINWAX® Tung Oil Finish
Product code	: 47500/67500
Other means of identification	: Not available.
Product type	: Liquid.
Relevant identified use	es of the substance or mixture and uses advised against
Not applicable.	
Manufacturer	: MINWAX Company 10 Mountainview Road Upper Saddle River, NJ 07458

Emergency telephone number of the company	: (216) 566-2917
Product Information Telephone Number	: (800) 523-9299
Regulatory Information Telephone Number	: (216) 566-2902
Transportation Emergency Telephone Number	: (800) 424-9300

Section 2. Hazards identification

OSHA/HCS status	 This material is considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200).
Classification of the substance or mixture	 FLAMMABLE LIQUIDS - Category 3 SKIN SENSITIZATION - Category 1 CARCINOGENICITY - Category 2 TOXIC TO REPRODUCTION (Fertility) - Category 2 SPECIFIC TARGET ORGAN TOXICITY (SINGLE EXPOSURE) (Respiratory tract irritation) - Category 3 SPECIFIC TARGET ORGAN TOXICITY (SINGLE EXPOSURE) (Narcotic effects) - Category 3 SPECIFIC TARGET ORGAN TOXICITY (REPEATED EXPOSURE) - Category 1 ASPIRATION HAZARD - Category 1
	Percentage of the mixture consisting of ingredient(s) of unknown oral toxicity: 64.7% Percentage of the mixture consisting of ingredient(s) of unknown dermal toxicity: 64.7% Percentage of the mixture consisting of ingredient(s) of unknown inhalation toxicity: 64. 7%
GHS label elements	
Hazard pictograms	
Signal word	: Danger

Section 2. Hazards identification

Hazard statements	ammable liquid and vapor. ay cause an allergic skin reaction. spected of damaging fertility. spected of causing cancer. ay be fatal if swallowed and enters airways. ay cause respiratory irritation. ay cause drowsiness or dizziness. suses damage to organs through prolonged or repeated exposure	
Precautionary statements		
General	ead label before use. Keep out of reach of children. If medical ac oduct container or label at hand.	lvice is needed, have
Prevention	otain special instructions before use. Do not handle until all safety en read and understood. Wear protective gloves. Wear eye or f ear protective clothing. Keep away from heat, hot surfaces, spart her ignition sources. No smoking. Use explosion-proof electrical, d all material-handling equipment. Use only non-sparking tools. easures against static discharge. Keep container tightly closed. I a well-ventilated area. Do not breathe vapor. Do not eat, drink o s product. Wash hands thoroughly after handling. Contaminated t be allowed out of the workplace.	ace protection. (s, open flames and ventilating, lighting Take precautionary Jse only outdoors or r smoke when using
Response	et medical attention if you feel unwell. IF exposed or concerned: ention. IF INHALED: Remove person to fresh air and keep com ill a POISON CENTER or physician if you feel unwell. IF SWALL mediately call a POISON CENTER or physician. Do NOT induce (IN (or hair): Take off immediately all contaminated clothing. Rin ower. IF ON SKIN: Wash with plenty of soap and water. Wash thing before reuse. If skin irritation or rash occurs: Get medical	fortable for breathing. OWED: vomiting. IF ON se skin with water or contaminated
Storage	pre locked up. Store in a well-ventilated place. Keep cool.	
Disposal	spose of contents and container in accordance with all local, regioner and container an	onal, national and
Supplemental label elements	ELAYED EFFECTS FROM LONG TERM OVEREXPOSURE. Corn n cause permanent brain and nervous system damage. Intention liberately concentrating and inhaling the contents can be harmful is product contains a chemical known to the State of California to other reproductive harm.	al misuse by or fatal. WARNING: cause birth defects
	ease refer to the SDS for additional information. Keep out of reac nsfer contents to other containers for storage.	h of children. Do not
Hazards not otherwise classified	NGER: Rags, steel wool, other waste soaked with this product, a ay spontaneously catch fire if improperly discarded. Immediately p ol, other waste soaked with this product, and sanding residue in etal container. Dispose of in accordance with local fire regulations	blace rags, steel a sealed, water-filled,

Section 3. Composition/information on ingredients

Substance/mixture	: Mixture
Other means of	: Not available.
identification	

CAS number/other identifiers

Ingredient name	% by weight	CAS number
Light Aliphatic Hydrocarbon	≥50 - ≤75	64742-47-8
Med. Aliphatic Hydrocarbon Solvent	≤10	64742-88-7
Methyl Ethyl Ketoxime	≤0.3	96-29-7
Cobalt 2-Ethylhexanoate	≤0.3	136-52-7

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified as hazardous to health and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Date of is	sue/Date of revision	: 7/2/2018	Date of previous issue	: 3/2/2018	Version : 9	2/13
47500/67	500 MINWAX® Tung	Oil Finish			SHW-85-NA-GHS-US	

Section 4. First aid measures

Description of necessary first aid measures		
Eye contact	 Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Get medical attention. 	
Inhalation	: Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Get medical attention. If necessary, call a poison center or physician. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.	
Skin contact	: Wash with plenty of soap and water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Get medical attention. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.	
Ingestion	: Get medical attention immediately. Call a poison center or physician. Wash out mouth with water. Remove dentures if any. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Aspiration hazard if swallowed. Can enter lungs and cause damage. Do not induce vomiting. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.	

Most important symptoms/effects, acute and delayed

Potential acute healt	n effects
Eye contact	: No known significant effects or critical hazards.
Inhalation	 Can cause central nervous system (CNS) depression. May cause drowsiness or dizziness. May cause respiratory irritation.
Skin contact	: May cause an allergic skin reaction.
Ingestion	 Can cause central nervous system (CNS) depression. May be fatal if swallowed and enters airways.
Over-exposure signs	/symptoms
Eye contact	: No specific data.
Inhalation	: Adverse symptoms may include the following: respiratory tract irritation coughing nausea or vomiting headache drowsiness/fatigue dizziness/vertigo unconsciousness reduced fetal weight increase in fetal deaths skeletal malformations
Skin contact	: Adverse symptoms may include the following: irritation redness reduced fetal weight increase in fetal deaths skeletal malformations

Section 4. First aid measures

Ingestion	: Adverse symptoms may include the following: nausea or vomiting reduced fetal weight increase in fetal deaths skeletal malformations
Indication of immediate me	dical attention and special treatment needed, if necessary
Notes to physician	 Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been ingested or inhaled.
Specific treatments	: No specific treatment.
Protection of first-aiders	: No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.

See toxicological information (Section 11)

Section 5. Fire-fighting measures

Extinguishing media	
Suitable extinguishing media	: Use dry chemical, CO ₂ , water spray (fog) or foam.
Unsuitable extinguishing media	: Do not use water jet.
Specific hazards arising from the chemical	: Flammable liquid and vapor. Runoff to sewer may create fire or explosion hazard. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. The vapor/gas is heavier than air and will spread along the ground. Vapors may accumulate in low or confined areas or travel a considerable distance to a source of ignition and flash back.
Hazardous thermal decomposition products	: Decomposition products may include the following materials: carbon dioxide carbon monoxide
Special protective actions for fire-fighters	: Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.
Special protective equipment for fire-fighters	: Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

For non-emergency personnel	:	No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Avoid breathing vapor or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.
For emergency responders	:	If specialized clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".
Environmental precautions	:	Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air).

Date of issue/Dat	e of revision	: 7/2/2018	Date of previous issue	: 3/2/2018	Version : 9	4/13
47500/67500	MINWAX® Tung Oil F	inish			SHW-85-NA-GHS-US	

Section 6. Accidental release measures

Methods and materia	als for containment and cleaning up
Small spill	: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.
Large spill	: Stop leak if without risk. Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Section 7. Handling and storage

Precautions for safe handling

Protective measures	: Put on appropriate personal protective equipment (see Section 8). Persons with a history of skin sensitization problems should not be employed in any process in which this product is used. Avoid exposure - obtain special instructions before use. Avoid exposure during pregnancy. Do not handle until all safety precautions have been read and understood. Do not get in eyes or on skin or clothing. Do not breathe vapor or mist. Do not swallow. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Take precautionary measures against electrostatic discharges. Empty containers retain product residue and can be hazardous. Do not reuse container.
Advice on general occupational hygiene	: Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.
Conditions for safe storage, including any incompatibilities	: Store in accordance with local regulations. Store in a segregated and approved area. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Store locked up. Eliminate all ignition sources. Separate from oxidizing materials. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabeled containers. Use appropriate containment to avoid environmental contamination. See Section 10 for incompatible materials before handling or use.

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits (OSHA United States)

Ingredient name	Exposure limits			
Light Aliphatic Hydrocarbon	ACGIH TLV (United States, 3/2017). Absorbed through skin. TWA: 200 mg/m ³ , (as total hydrocarbon vapor) 8 hours. OSHA PEL (United States, 6/2016). TWA: 100 ppm 8 hours. TWA: 400 mg/m ³ 8 hours.			
Med. Aliphatic Hydrocarbon Solvent				
Methyl Ethyl Ketoxime	AIHA WEEL (United States, 10/2011). Skin sensitizer.			
Date of issue/Date of revision : 7/2/2018 Date of previous issue	: 3/2/2018 Version : 9 5/13			
47500/67500 MINWAX® Tung Oil Finish	SHW-85-NA-GHS-US			

Section 8. Exposure controls/personal protection

 Cobalt 2-Ethylhexanoate	TWA: 10 ppm 8 hours. ACGIH TLV (United States, 3/2017).
	TWA: 0.02 mg/m ³ , (as Co) 8 hours.

Occupational exposure limits (Canada)

Ingredient name	Exposure limits
Solvent naphtha (petroleum), medium aliph.	CA British Columbia Provincial (Canada, 6/2017). Absorbed through skin. TWA: 200 mg/m³, (as total hydrocarbon vapour) 8 hours. CA Alberta Provincial (Canada, 4/2009). Absorbed through skin. 8 hrs OEL: 200 mg/m³, (as total hydrocarbon vapour) 8 hours. CA Ontario Provincial (Canada, 7/2015). Absorbed through skin. TWA: 200 mg/m³, (as total hydrocarbon vapour) 8 hours.
Med. Aliphatic Hydrocarbon Solvent	CA Quebec Provincial (Canada, 1/2014). TWAEV: 400 ppm 8 hours. TWAEV: 1590 mg/m ³ 8 hours. CA Ontario Provincial (Canada, 7/2015). TWA: 525 mg/m ³ 8 hours.
Methyl Ethyl Ketoxime	AIHA WEEL (United States, 10/2011). Skin sensitizer. TWA: 10 ppm 8 hours.
Cobalt 2-Ethylhexanoate	 CA Ontario Provincial (Canada, 7/2015). TWA: 0.02 mg/m³, (as Co) 8 hours. Form: Inorganic CA British Columbia Provincial (Canada, 6/2017). TWA: 0.02 mg/m³, (as Co) 8 hours. CA Quebec Provincial (Canada, 1/2014). Skin sensitizer. TWAEV: 0.02 mg/m³, (as Co) 8 hours. CA Saskatchewan Provincial (Canada, 7/2013). STEL: 0.06 mg/m³, (measured as Co) 15 minutes. TWA: 0.02 mg/m³, (measured as Co) 8 hours.

Occupational exposure limits (Mexico)

Ingredient name	Exposure limits
Solvent naphtha (petroleum), medium aliph.	ACGIH TLV (United States, 3/2017). Absorbed through skin. TWA: 200 mg/m ³ , (as total hydrocarbon
Cobalt 2-Ethylhexanoate	vapor) 8 hours. NOM-010-STPS-2014 (Mexico, 4/2016). TWA: 0.02 mg/m³, (as Co) 8 hours.

Appropriate engineering controls

: Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapor or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.

Environmental exposure controls

ŝ,

Date of issue/Dat	e of revision	: 7/2/2018	Date of previous issue	: 3/2/2018	Version :9	6/13
47500/67500	MINWAX® Tung Oil F	inish			SHW-85-NA-GHS-US	

Section 8. Exposure controls/personal protection

Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

Individual protection measures	
Hygiene measures :	Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.
Eye/face protection :	Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: safety glasses with side-shields.
Skin protection	
Hand protection :	Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.
Body protection :	Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear anti-static protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.
Other skin protection :	Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
Respiratory protection :	Based on the hazard and potential for exposure, select a respirator that meets the appropriate standard or certification. Respirators must be used according to a respiratory protection program to ensure proper fitting, training, and other important aspects of use.

Section 9. Physical and chemical properties

<u>Appearance</u>		
Physical state	: Liquid.	
Color	: Not available.	
Odor	: Not available.	
Odor threshold	: Not available.	
рН	: Not available.	
Melting point/freezing point	: Not available.	
Boiling point/boiling range	: 148°C (298.4°F)	
Flash point	: Closed cup: 39°C (102.2°F) [Tagliabue Closed Cup]	
Evaporation rate	: 0.13 (butyl acetate = 1)	
Flammability (solid, gas)	: Not available.	
Lower and upper explosive (flammable) limits	: Lower: 1% Upper: 6%	
Vapor pressure	: 0.17 kPa (1.27 mm Hg) [at 20°C]	
Vapor density	: 5 [Air = 1]	
Relative density	: 0.85	
Solubility	: Not available.	
Date of issue/Date of revision	: 7/2/2018 Date of previous issue : 3/2/2018 Version : 9	7/13

47500/67500 MINWAX® Tung Oil Finish

Section 9. Physical and chemical properties

: Not available.
: Not available.
: Not available.
: Kinematic (40°C (104°F)): <0.205 cm ² /s (<20.5 cSt)
: Not applicable.
: 26.923 kJ/g

Section 10. Stabil	ity and reactivity
Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur.
Conditions to avoid	: Avoid all possible sources of ignition (spark or flame). Do not pressurize, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition. Do not allow vapor to accumulate in low or confined areas.
Incompatible materials	: Reactive or incompatible with the following materials: oxidizing materials
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
Methyl Ethyl Ketoxime Cobalt 2-Ethylhexanoate	LD50 Oral LD50 Dermal LD50 Oral	Rabbit	930 mg/kg >5 g/kg 1.22 g/kg	- - -

Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
Methyl Ethyl Ketoxime	Eyes - Severe irritant	Rabbit	-	100 microliters	-

Sensitization

Not available.

Mutagenicity

Not available.

Carcinogenicity

Not available.

Classification

Product/ingredient name	OSHA	IARC	NTP
Cobalt 2-Ethylhexanoate	-	2B	Reasonably anticipated to be a human carcinogen.

Reproductive toxicity

Date of issue/Date	of revision	: 7/2/2018	Date of previous issue	: 3/2/2018	Version :9	8/13
47500/67500	MINWAX® Tung Oil Fi	nish			SHW-85-NA-GHS-US	

Section 11. Toxicological information

Not available.

Teratogenicity

Not available.

Specific target organ toxicity (single exposure)

Name		Route of exposure	Target organs
Light Aliphatic Hydrocarbon	Category 3	Not applicable.	Respiratory tract irritation and Narcotic effects
Med. Aliphatic Hydrocarbon Solvent	Category 3	Not applicable.	Respiratory tract irritation and Narcotic effects

Specific target organ toxicity (repeated exposure)

Name	 Route of exposure	Target organs
	 	Not determined Not determined

Aspiration hazard

Name	Result
	ASPIRATION HAZARD - Category 1 ASPIRATION HAZARD - Category 1

Information on the likely routes of exposure	t available.	
Potential acute health effe		
Eye contact	known significant effects or critical hazards.	
Inhalation	n cause central nervous system (CNS) depression. May cause drowsiness or ziness. May cause respiratory irritation.	
Skin contact	y cause an allergic skin reaction.	
Ingestion	n cause central nervous system (CNS) depression. May be fatal if swallowed ers airways.	and
Symptoms related to the p	I, chemical and toxicological characteristics	
Eye contact	specific data.	
Inhalation	verse symptoms may include the following: piratory tract irritation ughing usea or vomiting adache wsiness/fatigue ziness/vertigo consciousness luced fetal weight rease in fetal deaths eletal malformations	
Skin contact	verse symptoms may include the following: ation Iness Iuced fetal weight rease in fetal deaths eletal malformations	

Date of issue/Date	of revision	: 7/2/2018	Date of previous issue	: 3/2/2018	Version :9)	9/13
47500/67500	MINWAX® Tung Oil Fi	nish			SHW-85-NA-	-GHS-US	

Ind	est	ion

: Adverse symptoms may include the following: nausea or vomiting reduced fetal weight increase in fetal deaths skeletal malformations

Delayed and immediate ef	fects and also chronic effects from short and long term exposure
Short term exposure	
Potential immediate effects	: Not available.
Potential delayed effects	: Not available.
Long term exposure	
Potential immediate effects	: Not available.
Potential delayed effects	: Not available.
Potential chronic health ef	ifects
Not available.	
General	: Causes damage to organs through prolonged or repeated exposure. Once sensitized, a severe allergic reaction may occur when subsequently exposed to very low levels.
Carcinogenicity	 Suspected of causing cancer. Risk of cancer depends on duration and level of exposure.
Mutagenicity	: No known significant effects or critical hazards.
Teratogenicity	: No known significant effects or critical hazards.
Developmental effects	: No known significant effects or critical hazards.
Fertility effects	: Suspected of damaging fertility.

Numerical measures of toxicity Acute toxicity estimates Not available.

Section 12. Ecological information

-			
	OV		111/
	UAI		ILV
-		-	_

Product/ingredient name	Result	Species	Exposure
	10		4 days 96 hours

Persistence and degradability

Not available.

Bioaccumulative potential

Product/ingredient name	LogPow	BCF	Potential
Methyl Ethyl Ketoxime	-	2.5 to 5.8	low
Cobalt 2-Ethylhexanoate		15600	high

Mobility in soil

Soil/water partition coefficient (Koc)

: Not available.

Other adverse effects

: No known significant effects or critical hazards.

Date of issue/Dat	e of revision	: 7/2/2018	Date of previous issue	: 3/2/2018	Version :9	10/13
47500/67500	MINWAX® Tung O	il Finish			SHW-85-NA-	GHS-US

Section 13. Disposal considerations

Disposal methods

The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Vapor from product residues may create a highly flammable or explosive atmosphere inside the container. Do not cut, weld or grind used containers unless they have been cleaned thoroughly internally. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Section 14. Transport information

	DOT Classification	TDG Classification	Mexico Classification	IATA	IMDG
UN number	UN1263	UN1263	UN1263	UN1263	UN1263
UN proper shipping name	PAINT	PAINT	PAINT	PAINT	PAINT. Marine pollutant (Cobalt 2-Ethylhexanoate)
Transport hazard class(es)	3	3	3	3	
Packing group	III	III	III	Ш	III
Environmental hazards	No.	No.	No.	Yes. The environmentally hazardous substance mark is not required.	Yes.
Additional information	This product may be re-classified as "Combustible Liquid," unless transported by vessel or aircraft. Non-bulk packages (less than or equal to 119 gal) of combustible liquids are not regulated as hazardous materials.	Product classified as per the following sections of the Transportation of Dangerous Goods Regulations: 2. 18-2.19 (Class 3).	-	The environmentally hazardous substance mark may appear if required by other transportation regulations.	The marine pollutant mark is not required when transported in sizes of ≤5 L or ≤5 kg. <u>Emergency</u> <u>schedules</u> F-E, S- E
	<u>ERG No.</u>	ERG No.	ERG No.		
	128	128	128		

Section 14. Transport information

Special precautions for user	Multi-modal shipping descriptions are provided for informational purposes an consider container sizes. The presence of a shipping description for a particul mode of transport (sea, air, etc.), does not indicate that the product is packag suitably for that mode of transport. All packaging must be reviewed for suitab prior to shipment, and compliance with the applicable regulations is the sole responsibility of the person offering the product for transport. People loading unloading dangerous goods must be trained on all of the risks deriving from t substances and on all actions in case of emergency situations.	
Transport in bulk according to Annex II of MARPOL and the IBC Code	: Not available.	
	Proper shipping name	: Not available.
	Ship type	: Not available.
	Pollution category	: Not available.

Section 15. Regulatory information

SARA 313


SARA 313 (40 CFR 372.45) supplier notification can be found on the Environmental Data Sheet.

California Prop. 65

WARNING: This product contains a chemical known to the State of California to cause birth defects or other reproductive harm.

Section 16. Other information

Hazardous Material Information System (U.S.A.)

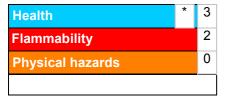

The customer is responsible for determining the PPE code for this material. For more information on HMIS® Personal Protective Equipment (PPE) codes, consult the HMIS® Implementation Manual.

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks. Although HMIS® ratings and the associated label are not required on SDSs or products leaving a facility under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used with a fully implemented HMIS® program. HMIS® is a registered trademark and service mark of the American Coatings Association, Inc.

Procedure used to derive the classification

Classification	Justification
FLAMMABLE LIQUIDS - Category 3	On basis of test data
SKIN SENSITIZATION - Category 1	Calculation method
CARCINOGENICITY - Category 2	Calculation method
TOXIC TO REPRODUCTION (Fertility) - Category 2	Calculation method
SPECIFIC TARGET ORGAN TOXICITY (SINGLE EXPOSURE) (Respiratory tract irritation) - Category 3	Calculation method
SPECIFIC TARGET ORGAN TOXICITY (SINGLE EXPOSURE) (Narcotic effects) - Category 3	Calculation method
SPECIFIC TARGET ORGAN TOXICITY (REPEATED EXPOSURE) - Category 1	Calculation method
ASPIRATION HAZARD - Category 1	Calculation method

Date of previous issue

Date of printing	: 7/2/2018
Date of issue/Date of revision	: 7/2/2018
Date of previous issue	: 3/2/2018
Version	: 9
Date of issue/Date of revision	: 7/2/2018

Date of issue/Date of revision 47500/67500 MINWAX®

7500 MINWAX® Tung Oil Finish

: 3/2/2018

Section 16. Other information

Key to abbreviations	: ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals
	IATA = International Air Transport Association IBC = Intermediate Bulk Container
	IMDG = International Maritime Dangerous Goods
	LogPow = logarithm of the octanol/water partition coefficient
	MARPOL = International Convention for the Prevention of Pollution From Ships, 1973
	as modified by the Protocol of 1978. ("Marpol" = marine pollution)
	UN = United Nations

Notice to reader

It is recommended that each customer or recipient of this Safety Data Sheet (SDS) study it carefully and consult resources, as necessary or appropriate, to become aware of and understand the data contained in this SDS and any hazards associated with the product. This information is provided in good faith and believed to be accurate as of the effective date herein. However, no warranty, express or implied, is given. The information presented here applies only to the product as shipped. The addition of any material can change the composition, hazards and risks of the product. Products shall not be repackaged, modified, or tinted except as specifically instructed by Sherwin-Williams, including but not limited to the incorporation of non Sherwin-Williams products or the use or addition of products in proportions not specified by Sherwin-Williams. Regulatory requirements are subject to change and may differ between various locations and jurisdictions. The customer/buyer/user is responsible to ensure that his activities comply with all country, federal, state, provincial or local laws. The conditions for use of the product are not under the control of the manufacturer; the customer/buyer/user is responsible to determine the conditions necessary for the safe use of this product. The customer/buyer/user should not use the product for any purpose other than the purpose shown in the applicable section of this SDS without first referring to the supplier and obtaining written handling instructions. Due to the proliferation of sources for information such as manufacturer-specific SDS, the manufacturer cannot be responsible for SDSs obtained from any other source.